

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch

690 Walnut Ave.St. 150

Vallejo, CA 94592-1133

(707) 649-5453

(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:**Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-020638**Date Inspected:** 16-Feb-2011**Project Name:** SAS Superstructure**OSM Arrival Time:** 1900**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 700**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** See Below**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** OBG**Summary of Items Observed:**

CWI Inspector: Mr. Lv Li Qing


On this date CALTRANS OSM Quality Assurance (QA) Inspector, Mr. Paul Dawson, arrived on site at the Zhenhua Port Machinery Company (ZPMC) facility at Changxing Island, in Shanghai China, for the purpose of monitoring welding and fabrication of the San Francisco / Oakland Bay Bridge (SFOBB) components. This QA Inspector observed the following:

OBG Bay 14

This QA Inspector observed ZPMC welder Mr. Yang Yunfeng, stencil 215553 used shielded metal arc welding procedure WPS-casting-SMAW-1G-Repair-1 to make a weld repair of visual rejections to OBG segment 14E anchor plate bearing block casting #087-1. ZPMC QC informed this QA Inspector that critical weld repair document B-CWR-2784 documents this weld repair. This QA Inspector measured a welding current of approximately 190 amps and Mr. Yang Yunfeng appeared to be certified to make this weld. Items observed on this date appeared to generally comply with applicable contract documents. See the photographs below for additional information.

WELDING INSPECTION REPORT

(Continued Page 2 of 2)

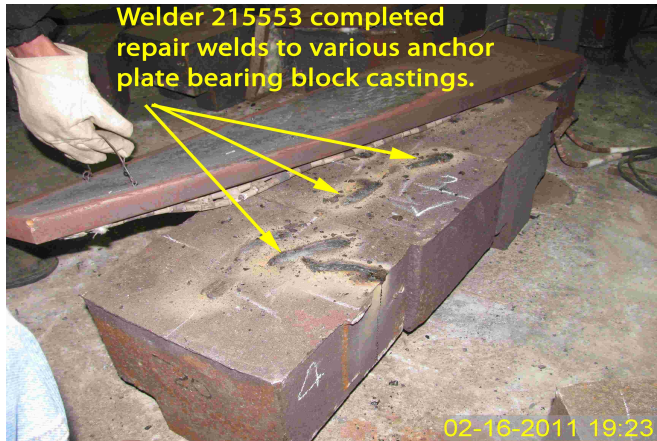

Summary of Conversations:

See Above.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact James Devey +8615000026784, who represents the Office of Structural Materials for your project.

Inspected By: Dawson,Paul

Quality Assurance Inspector

Reviewed By: Riley,Ken

QA Reviewer